

## IAQ SERIES HUMIDIFIER VAPOR PAD REPLACEMENT

## **INSTALLATION INSTRUCTIONS**

## INSTALLATION

This evaporator pad is designed to fit the HUMBSBP-12H6--A or HUMBLBP-17H6--A humidifier models. The evaporator pad is coated with a non-soluble wetting agent to increase humidifier efficiency. Some of the coating may dust off during transit. This will not affect the efficiency of the evaporator pad.

To replace a used pad, remove the front cover by pulling the snap on the bottom/underside of the cover out & down (Figure 2). Lift the cover off the tabs on top (Figure 1). Remove the vapor pad assembly (includes the trough, drain pan and vapor pad) from the humidifier. Lift the trough off the top and slide used pad out of drain pan.

Clean excessive mineral deposits from trough and drain pan. Flush mineral deposits out of drain hose to prevent overflow condition during heating season.

With black patch on vapor pad on the top (opposite side of the drain pan, see Figure 3), place the evaporator pad into drain pan. Replace trough. Install pad assembly, etc. Replace cover by first aligning the top "tabs" and then "Snapping" the cover back on.

If humidifier has been in service for more than three years, remove the strainer assembly at the inlet of the solenoid valve. Pull the orifice fitting from the outlet of the solenoid valve and clean all parts. If the orifice is clogged, it may be opened by inserting a small needle.

Start air handler blower and check operation of unit after servicing. Ensure no leaks are present before leaving.

Humidifier Model	Replacement Evaporator Pad Part
HUMBSBP-12H6A	7738002906
HUMBLBP-17H8A	7738001907

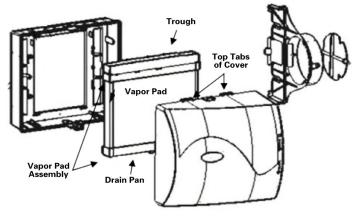


Figure 1

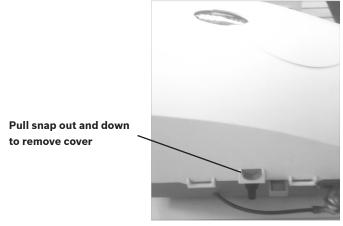


Figure 2

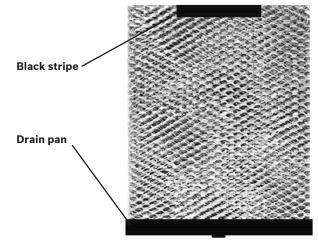


Figure 3

For technical support or replacement parts, contact:

Bosch Group (954) 776-5471 Monday-Friday: 8am – 5 pm EST

601 N.W. 65th Court Ft. Lauderdale, FL 33309



601 N.W. 65th Court, Ft. Lauderdale, FL 33309 Phone: 954-776-5471 | Fax: 954-776-5529 www.bosch-climate.us